

机器收到后，在图上圈出的位置，加入40升的液压油


After receiving the machine, add 40 liters of hydraulic oil to the area circled on the diagram.





接入三根线

Connect three wires

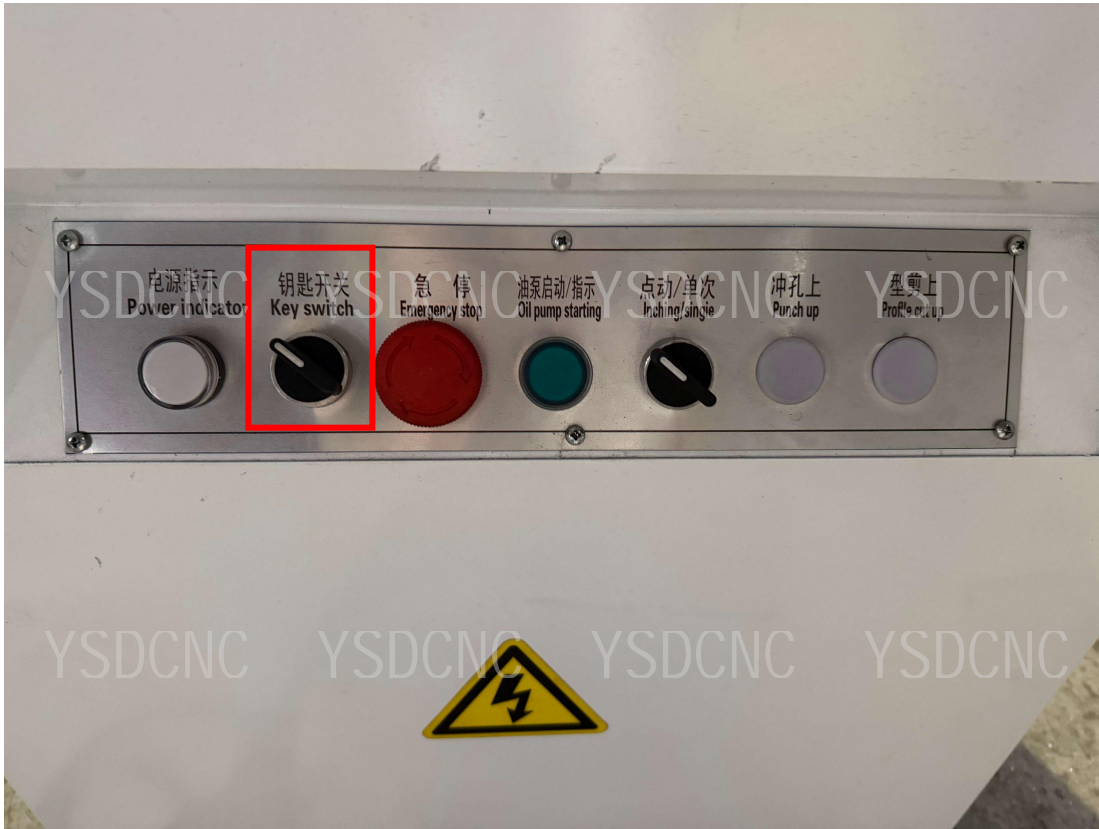

打开钥匙开关，白色指示灯亮起

When the key switch is turned on, the white indicator light illuminates.

打开急停开关


Turn on the emergency stop switch



油泵启动，机器开始运行

The oil pump starts, and the machine begins to run.



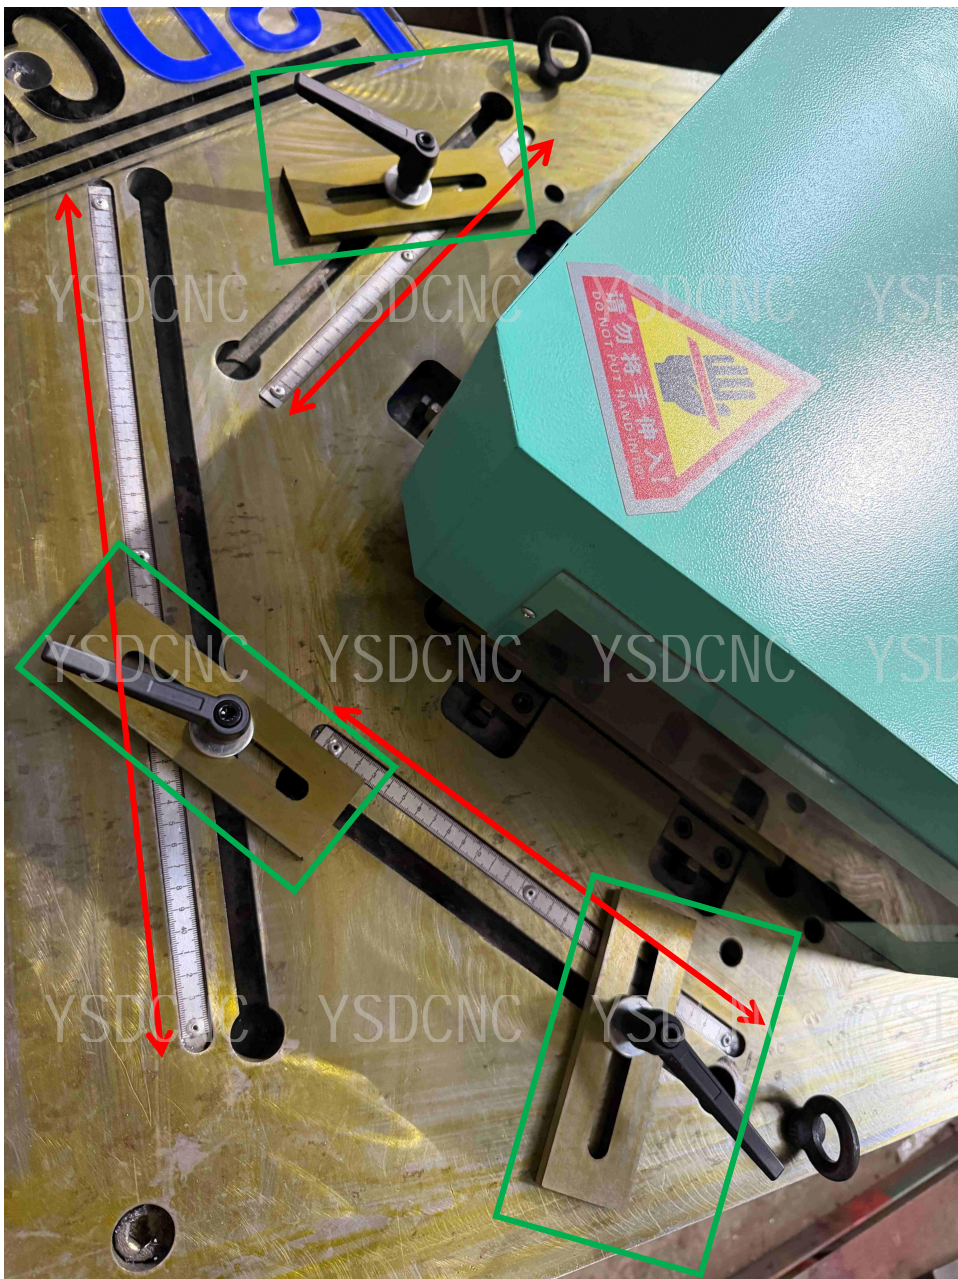

这个量尺是用来测量切多长的切口

例如：你要切30mm，那么就把可调节挡块固定在30mm的位置，

然后抵着可调节挡块送入金属板开始切角

红色箭头标注为量尺

绿色方框内为可调节挡块

This measuring tool is used to measure the length of the cut.

For example, if you want to cut a 30mm slit, fix the adjustable stop at the 30mm position.

Then, using the adjustable stop as a guide, insert the metal plate to begin cutting the slit.

The red arrow indicates the measuring tool. The green box indicates the adjustable stop.

送入金属板，踩下脚踏开关开始切角

Insert the metal plate, press the foot switch to start cutting the corner.

